

Work Order ID 128041

128041

Page 1

December-23-14 7:54:48 AM

Item ID: D412-664-203

Accept

N900040100

Setup Start *NS1*

Revision ID:

Stop *NS2*

Item Name: Aft Crosstube - High

Start Date: 12/23/14 Start Qty: 1.00 *1*

Cust Item ID:

Required Date: 1/09/15 Req'd Qty: 1.00 *1*

Customer:

Reference:

Approvals: Process Plan: ✓ Date: _____ Tooling: _____ Date: _____
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Run Start *NR1*
Stop *NR2*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr	Revision Nbr
D412-664-243	F

100	Document Control	0.00							
100	DOCUMENT CONTROL								
DC	Memo	0.00							
Doc.Control -USB or Paperwork	Photocopy bluefile and create labels as per PPP D412-664-203 CHG 010								

MLJ 15-02-24

DAS 27 9-89

(1x)

DAS 46 FEB 27 2015

110	Packaging	0.00							
110	Packaging								
Packaging	Memo	0.00							
Packaging									

BCL 15/01/30

120	BENDING MACHINE - CROSSTUBES	0.00							
120	CNC Bend 2								
CNC Alpha 160 Bender	Memo	0.00							
	Bend tube as per Dwg D412-664-243 using CNC bender program 412-aft and Folio FT010								

middle BCL 15/01/30

side BL 15/02/02

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube ☐</td> <td>Crosstube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence
		☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge
		☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other

Work Order ID 128041

128041

Page 2

December-23-14 7:54:48 AM

Item ID: D412-664-203 Accept *N900040100* Setup Start *NS1*
 Revision ID: Stop *NS2*
 Item Name: Aft Crosstube - High
 Start Date: 12/23/14 Start Qty: 1.00 *1* Cust Item ID:
 Required Date: 1/09/15 Req'd Qty: 1.00 *1* Customer:
 Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start *NR1*
 QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop *NR2*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
130	QC15- Crosstube Dimensional Check	0.00							DAS 38 9-89
130									
QC	Memo	0.00							
Quality Control									
140		0.00							
140	Crosstubes	0.00							
Crosstubes	Memo								
Crosstubes	1-Drill pilot holes in tube as per Dwg D412-664-243 using drill Jig DT8550 & DT8551 and drill table DT8577 using #9 holes as per QSI 10 to install towers.								
	2-Ream hole to finish size in tube as per Dwg D412-664-243 using drill Jig DT8550 & DT8551. Check dimensions between holes, both sides on both cuffs, to ensure alignment with saddle holes.								
	3-SCRIBE PART # & BATCH #								
	4- *** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE*** Deburr & Inspect for surface damage. Repair damage within limits as per Dwg D412-664-243								

BL 15/02/04
 BL 15/02/05

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube ☐</td> <td>Crosstube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	--	---

Work Order ID 128041

128041

Page 3

December-23-14 7:54:48 AM

Item ID: D412-664-203

Accept

N900040100

Setup Start

NS1

Revision ID:

Stop

NS2

Item Name: Aft Crosstube - High

Start Date: 12/23/14 Start Qty: 1.00

1

Cust Item ID:

Required Date: 1/09/15 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start

NR1

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop

NR2

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
160	QC5- Inspect part completeness to step on W/O	0.00				1			DAS 38 9-89
160									DAS 49 9-89
QC	Memo	0.00							1/02/09
Quality Control	*** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE***								DAS 41 9-89
170		0.00				1			15-2-9
170									
HandFXtube	Memo	0.00							
Hand Finishing Crosstubes	*** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE***								
	1- CLEAN CROSSTUBE WITH WASH'N WIPE								
180	Outsource process - NDT per QSI038 4.1	0.00							
180									
Outsource2	Memo	0.00							
Outsource process - NDT	*** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE***								
	Liquid Penetrant Inspection as per QSI 038Or Issue P/O 27380 LPI as per ASTM 1417 Level 2 Attach copy of NDT results to work order								

Received

SP 1x 15-02-9.

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube ☐</td> <td>Crosstube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence	☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	--	---	--

Work Order ID 128041***128041***

Page 4

December-23-14 7:54:48 AM

Item ID: D412-664-203

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Aft Crosstube - High

Start Date: 12/23/14 Start Qty: 1.00

1

Cust Item ID:

Required Date: 1/09/15 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

190

0.00

190

Packaging

Packaging

Memo

0.00

*** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE***

Inspect for transit damage

Ensure copy of NDT results attached to work order.

see last page

200

QC5- Inspect part completeness to step on W/O

0.00

200

QC

Memo

0.00

*** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE***

Inspect for damage & ensure results are as per Dwg D412-664-203

DAS

38

9-89

15-02-09

203

0.00

203

HandFXtube

Memo

0.00

*** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE***

1- PRESSURE WASH AND THEN USE WASH'N WIPE TO CLEAN
CROSSTUBE BEFORE CHEMICAL CONVERSION

DAS

41

9-89

15-2-9

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube ☐</td> <td>Crosstube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	--	---

Work Order ID 128041***128041***

Page 5

December-23-14 7:54:48 AM

Item ID: D412-664-203

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Aft Crosstube - High

Start Date: 12/23/14 Start Qty: 1.00

1

Cust Item ID:

Required Date: 1/09/15 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

205

QC7-Inspect Chemical Conversion Coat

0.00

205

QC

Memo

0.00

Quality Control

*** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE***

1 _____ *EB*
15-02-10

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube ☐</td> <td>Crosstube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence	☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	--	---	--

Work Order ID 128041

December-23-14 7:54:48 AM

128041

Page 6

Item ID: D412-664-203

Accept

N900040100

Setup Start

NS1

Revision ID:

Stop

NS2

Item Name: Aft Crosstube - High

Start Date: 12/23/14 Start Qty: 1.00

1

Cust Item ID:

Required Date: 1/09/15 Req'd Qty: 1.00

1

Customer:

Reference:

Run Start

NR1

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Stop

NR2

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
210	SprayPaint	0.00				1			DAS 41 9-89
210									
SprayPaint	Memo	0.00							
Spray Painting	*** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE***								15-2-18

Mask underside of crosstube as shown

1-Prime inside and outside crosstube as per QSI 005 4.2 AND DWG

PRIMER: 129807
START TIME: 300
FINISH TIME: 400

2-Paint outside crosstube with White Imron as per DWG D412-664-243 and QSI 005 4.2

PAINT: 131599
Start Time: 100
Finish Time: 200

3- Apply clear coat after paint as per DWG

130762

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube ☐</td> <td>Crosstube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence	☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	--	---	--

Work Order ID 128041***128041***

Page 7

December-23-14 7:54:48 AM

Item ID: D412-664-203

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Aft Crosstube - High

Start Date: 12/23/14 Start Qty: 1.00

1

Cust Item ID:

Required Date: 1/09/15 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

220

QC14- Inspect Spray Paint

0.00

220

QC

Memo

0.00

Quality Control

Then, Wrap in plastic bag to protect from scratches

DAS

38

9-89

15-02-23

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube ☐</td> <td>Crosstube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence	☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	--	---	--

Work Order ID 128041

December-23-14 7:54:48 AM

128041

Page 8

Item ID: D412-664-203 Accept *N900040100* Setup Start *NS1*
 Revision ID: Stop *NS2*
 Item Name: Aft Crosstube - High
 Start Date: 12/23/14 Start Qty: 1.00 *1* Cust Item ID:
 Required Date: 1/09/15 Req'd Qty: 1.00 *1* Customer:
 Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start *NR1*
 QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop *NR2*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
230		0.00							DAS
230	Crosstubes					1			41
Crosstubes									9-89
Crosstubes	Memo	0.00							15-2-21

Assemble as per Dwg D412-664-203

1- Install center support using scoth-weld DP460 per QSI 015, as per DWG. note 13. Install supports clamps using as per Dwg D412-644-243. Install clamp with rubber cushion as per DWG. note 14. ***ENSURE CLAMPS ARE ON TOP OF CROSSTUBE SUPPORT*** Torque clamps on support to 80-100 IN-LBS AS PER DWG.

A/R scoth-weld DP460 BATCH #: 130684
 EXP DATE: 10/15

2- **IF NOT ALREADY PRESENT ON CHAFFING SHEILD.** Apply a thin coat of proseal 890 per QSI 015 on inside concave surface of chafing shield and let cure per manufacturer's instructions. Install prosealed chafing shield onto crosstube by applying a thin coat of proseal 890 onto crosstube. Be sure to eliminate any air gaps. Install and torque clamps on chafing shield to 40-50 IN-LBS AS PER DWG.

A/R Proseal 890 Batch: 130986
 EXP DATE: 6/15

AFTER FINISH CURE TIME 24H
 START CURE TIME: 15-2-21
 FINISH CURE TIME: 15-2-22

PRIOR TO PACKAGING RE-CHECK TORQUE ON CLAMPS AFTER CURED FOR 24H.

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube ☐</td> <td>Crosstube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence
		☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge
		☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube ☐</td> <td>Crosstube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence
		☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge
		☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other

Work Order ID 128041***128041***

Page 10

December-23-14 7:54:48 AM

Item ID: D412-664-203

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Aft Crosstube - High

Start Date: 12/23/14 Start Qty: 1.00

1

Cust Item ID:

Required Date: 1/09/15 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
270	Packaging	0.00							
270							DAG		
Packaging	Memo	0.00					27		
Packaging	Identify and pack for shipping as per PPP D412-664-203 *****Ensure tube is not packaged if curing time is less than 12 hrs, see step 27 for application time & date ***** Time & date of packaging: _____ Location: BK001						8-29		
280	QC21- Final Inspection - Work Order Release	0.00							
280									
QC	Memo	0.00							
Quality Control									

MAR 03 2015

MLJ 15-03-04

15.3.3

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube ☐</td> <td>Crosstube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence	☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	--	---	--

Picklist Print

December-23-14 7:54:47 AM

Page 1

Work Order ID: 128041

128041

Parent Item: D412-664-203

D412-664-203

Parent Item Name: Aft Crosstube - High

Start Date: 12/23/14

Required Date: 1/09/15

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP Rev:E04.02.16Reformat; Added D3189-1K/DS
 IPP Rev:F 06-03-29 Remove Coments on Pick List JLM
 IPP Rev:G 06.12.08 per ECN 886 EC
 IPP Rev:H 07-04-30 As per Rev D JLM
 IPP Rev:I 08-06-12 add comment in seq. 21 DD verified by:EC IPP rev J
 11.04.21 DEO D412-664-243-E-1 EC verified DD IPP REV:K
 11.10.03 DEO D412-664-243-E-2 DD verf:EC

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
AN6-40A		Purchased	No			250	Each	72.0000	4	4			
AN6-40A	DAS								**			DAS	
Bolt	46											27	
	9-89											FEB 24 2015	
				<u>Location</u>				<u>Loc Qty</u>		<u>Loc Code</u>			
				ST286A				50					DAS
				M129521				50					28
				ST333				22					9-89
				M130466				22					
AN6-41A		Purchased	No			250	Each	43.0000	2	2			
AN6-41A	DAS								**			DAS	
Bolt	46											27	
	9-89											FEB 24 2015	
				<u>Location</u>				<u>Loc Qty</u>		<u>Loc Code</u>			
				ST286A				30					DAS
				M129913				30					28
				ST333				13					9-89
				M129934				13					
D2896-1		Manufactured	No			230	Each	13.0000	1	1			
D2896-1									**			DAS	
Support												41	
												9-89	15-2-21
				<u>Location</u>				<u>Loc Qty</u>		<u>Loc Code</u>			
				LG052				13					
				115385				13					

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube ☐</td> <td>Crosstube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence
		☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge
		☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other

Picklist Print

December-23-14 7:54:47 AM

Page 2

Work Order ID: 128041

128041

Parent Item: D412-664-203

D412-664-203

Parent Item Name: Aft Crosstube - High

Start Date: 12/23/14

Required Date: 1/09/15

Start Qty: 1.00

Required Qty: 1.00

D3189-1 Manufactured No

230 Each

24.0000 2 2

D3189-1

Chaffing Shield

DAS
41
9-89

15-2-21

Location

Loc Qty

Loc Code

FG

2

36065

2

LG053

22

119738

22

2

D3595-063-570

Manufactured No

230 Each

144.0000 2 2

D3595-063-570

Rubber Cushion

DAS
41
9-89

15-2-21

Location

Loc Qty

Loc Code

FG

12

42243

12

LG051

132

115707

84

2

116260

48

D412-664-203TRN

Manufactured No

110 Each

5.0000 1 1

D412-664-203TRN

Crosstube Turning Detail

Location

Loc Qty

Loc Code

LG014

5

124783

1

124784

1

124830

1

124831

1

124832

1

132 15/01/30

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube ☐</td> <td>Crosstube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence
		☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge
		☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other

Picklist Print

December-23-14 7:54:47 AM

Page 3

Work Order ID: 128041

Parent Item: D412-664-203

Parent Item Name: Aft Crosstube - High

128041

D412-664-203

Start Date: 12/23/14

Required Date: 1/09/15

Start Qty: 1.00

Required Qty: 1.00

MS21042L6

Purchased

No

250

Each

136.0000

6

6

DAS
27
9-89

MS21042L6

Nut

DAS
46
9-89

Location

Loc Qty

Loc Code

ST305

136

m129909

36

m130799

100

FEB 24 2015

DAS
28
9-89

MS21920-28

Purchased

No

230

Each

69.0000

4

4

DAS
41
9-89

MS21920-28

Clamp

Location

Loc Qty

Loc Code

FG

1

105884

1

LG050

68

M130400

50

M130665

18

MS21920-30

Purchased

No

230

Each

51.0000

2

2

DAS
41
9-89

MS21920-30

Clamp

Location

Loc Qty

Loc Code

LG050

50

m126453

2

m128827

48

LG051

1

m126336

1

NAS1149D0663J

Purchased

No

250

Each

400.0000

18

18

DAS
27
9-89

NAS1149D0663J

Washer

DAS
46
9-89

Location

Loc Qty

Loc Code

ST269

400

M126334

400

DAS
28
9-89

December-23-14 7:54:47 AM

Shop Packet Print

Page 3

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube ☐</td> <td>Crosstube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																


Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence	☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	--	---	--

DART AEROSPACE LTD		Work Order: 128041
Description: Crosstube High Aft (412)		Part Number: D412-664-203
Inspection Dwg: D412-664-243	Rev: F	Page 1 of 1

Required Dimension	Min	Max
Height	24.12	24.62
1/2 Span	53.59	53.85
Angle	49	52
Total Span	107.18	107.70
Bending Passes	8	--
Crushing	--	7%

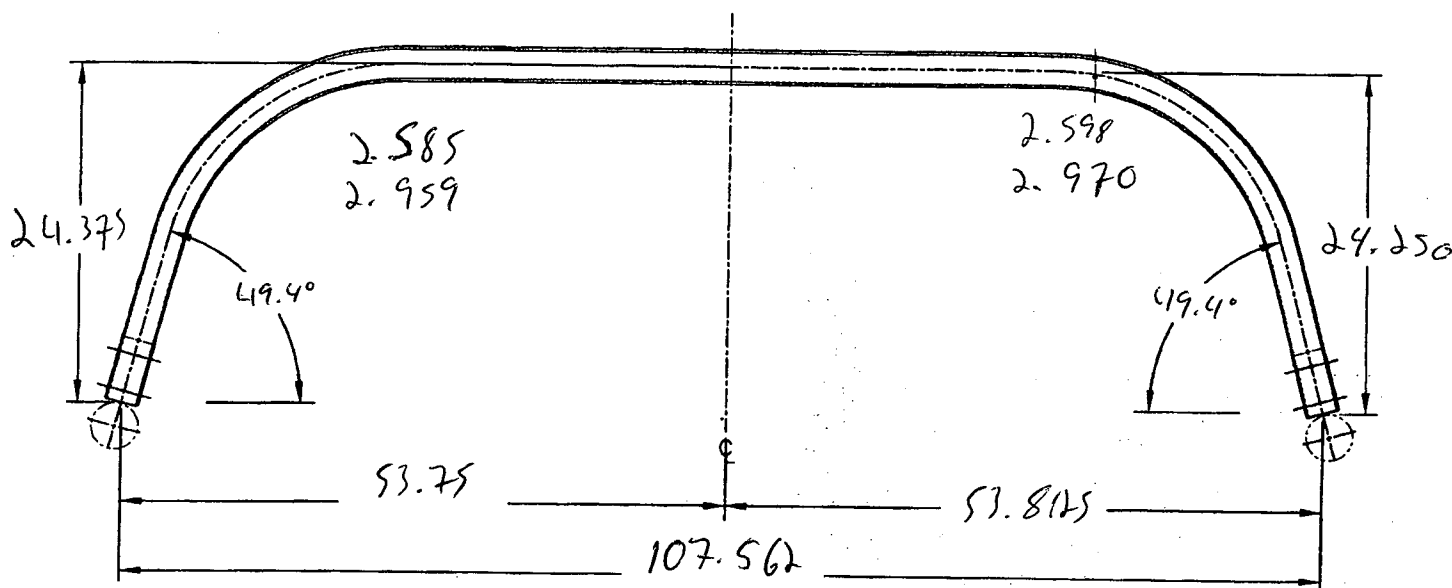

	Side A	Side B
Bending Passes	10	10
Crushing	6.7%	6.7%
Comments		

QC15 Inspection	36
Date	FEB 03 2015

Rev	Date	Change	Revised by	Approved
A	07.02.06	New Issue	KJ/JM	
B	07.05.08	Dimensions updated per Dwg rev. D	KJ/JLM	
C	10.02.02	Dwg Rev updated	KJ	
D	12.04.16	Added bending, crushing dimensions	KJ	
E	14.09.08	Max crushing % revised	KJ	

Item	Qty -243	Part Number	Description
1	X	D412-664-243	CROSSTUBE ASSEMBLY (412 HIGH AFT)
2	1	D6009-129	CROSSTUBE
3	2	D3595-063-570	RUBBER CUSHION
4	1	D2896-1	SUPPORT
5	2	D3189-1	CHAFING SHIELD
7	4	MS21920-28	CLAMP
8	2	MS21920-30	CLAMP (OR MS21920-32)
9	A/R	SCOTCH-WELD DP460	EPOXY ADHESIVE, 3M SCOTCH-WELD
10	A/R	PROSEAL 890 B-2	SEALANT

GENERAL NOTES:

- 1) MATERIAL: MANUFACTURED FROM D6009-129
FINISHED LENGTH = 124.100±0.020 (BEFORE BENDING)
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
MASK UNDERSIDE OF CROSSTUBE AS SHOWN (ZN C6-2, HATCHED AREA)
PAINT OUTSIDE PER DART QSI 005 4.2
AFTER PAINTING, REMOVE MASKING AND APPLY MATTE CLEAR COAT
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED.
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- 6) IDENTIFICATION: DART P/N "D412-664-243" AND B/N ON INSIDE OF CUFF PER QSI 044 6.4 (VIBRATING STYLUS)
- 7) WEIGHT: 47.0 lbs
- 8) PART IS SYMMETRIC ABOUT CENTERLINE.
- 9) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE. DO NOT GRIND TUBE AFTER SHOT PEEN.

TURNING

- 10) WHEN TRANSITIONING TO STOCK MAT'L, RUN CUTTER OFF PART. BLEND OUT EDGE LONGITUDINALLY. TRANSITION SHOULD BE SMOOTH.

BENDING

- 11) BEND PROGRESSIVELY WITH A MINIMUM OF 8 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 7% (BASED ON O.D.) IN LOWER HALF OF R30 BEND AND 6% (BASED ON O.D.) ON REMAINING TUBE.
- 12) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038. TO BE PERFORMED AFTER FINAL POST-BEND GRINDING. ANY ADDITIONAL GRINDING REQUIRES ANOTHER LPI INSPECTION.

ASSEMBLY

- 13) INSTALL D2896-1 CENTER SUPPORT USING A 0.04" TO 0.07" THICK LAYER OF SCOTCH-WELD DP460 PER QSI 015.
- 14) INSTALL MS21920-30 CLAMPS (OR -32) WITH D3595-063-570 RUBBER CUSHIONS TO SECURE THE D2896-1 SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMPS ARE ON TOP SIDE OF CROSSTUBE.
- 15) APPLY A THIN COAT OF PROSEAL 890 ON INSIDE CONCAVE SURFACE OF D3189-1 CHAFING SHIELD AND LET CURE PER MANUFACTURER'S INSTRUCTIONS. INSTALL PROSEALED D3189-1 CHAFING SHIELD ONTO CROSSTUBE BY APPLYING A THIN COAT OF PROSEAL 890 ONTO CROSSTUBE. BE SURE TO ELIMINATE ANY AIR GAPS.
- 16) TORQUE CLAMPS ON D2896-1 SUPPORT 80 TO 100 IN-LB. TORQUE CLAMPS ON D3189-1 CHAFING SHIELD 40 TO 50 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING. PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER ADHESIVES HAVE CURED FOR 24 HOURS.

who 128044

RELEASED
2014-05-26

F	NOTES RE-ORDERED, SCOTCH-WELD WAS MAGNOBOND (C8-1), ADD CLAMP RETORQUE (A8-1), REMOVE ABRASION STRIP, ADD INSPECTION WINDOW (C8-1), CHAFING SHIELD NOW 4.38 WIDE (C6-2), ADD 7% CRUSHING (B8-1), CHG BEND HEIGHT TOL. TO ±0.25 (C1-3), CHG CUFF TOL. (D2-4), CLAMPS FLIPPED TO PREVENT CHAFING (B7-2, B7-3), INCORP. DEO E-2/4	CP	14.04.01
E	REFORMAT/REVISE GENERAL NOTES: REORGANIZED VIEWS AND REFORMATTED DRAWING TO CURRENT STANDARDS; RELOCATED FLAG #8 PER PAR 08-046 (ZN A8-3); ADD TOLERANCE (ZN B6-3, C4-3, C8-3 & C5-3); MOVED TURNING DETAIL & UPDATED TOLERANCE TO SHEET 4.	RF	09.09.30
D	REMOVE D2732-058, CHANGE TO D3595-063-570	PH	07.03.09
C	REMOVE D2856-600-1087, ADD D2732-058 & MAGNOBOND 6398, MS21920-32 WAS MS21920-30	MB	06.10.27
B	ADD HOLES FOR COMPATABILITY WITH BHT/AA SKIDTUBES	PH	05.02.04
A	NEW ISSUE	PH	01.10.17
REV.	DESCRIPTION	BY	DATE
DESIGN	<i>Q</i>	DART AEROSPACE LTD	
DRAWN	<i>Q</i>	HAWKESBURY, ONTARIO, CANADA	
CHECKED	<i>DW</i>	DRAWING NO.	REV. F
MFG. APPR.	<i>Q</i>	D412-664-243	SHEET 1 OF 4
APPROVED	<i>Q</i>	TITLE	SCALE
DE APPR.	<i>Q</i>	CROSSTUBE ASSEMBLY (412 HI AFT)	NTS
DATE	14.04.01	COPYRIGHT © 2001 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____



Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube ☐</td> <td>Crosstube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																


Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear	General		
☐ Bending	☐ Bend	☐ Folio/Program	☐ Outside Dimensions
☐ Centre Not Concentric	☐ BOM/Route	☐ Grain	☐ Over/Under tolerance
☐ Cracks	☐ Broken/Damage/Defect	☐ Hardware	☐ Part Incorrect
☐ Crimp/Kink/Ripple/Wave	☐ Burrs	☐ Inspection Incomplete/Unqualified	☐ Part Lost/Missing
☐ Cuffs	☐ Contamination	☐ Instructions Incomplete/Unclear	☐ Part Moved
☐ Crushing	☐ Countersink	☐ Misaligned/off center	☐ Positioned Wrong
☐ Heat Treat	☐ Cut Too Short	☐ Mislabeled	☐ Power Loss/Surge
☐ Inspection Strip in Tube	☐ Drawing	☐ Misread	☐ Pressure/Forced
☐ Marks/Chatter	☐ Drill Holes	☐ Off-set	☐ Set-up
☐ Turning Sequence	☐ Finish	☐ Out of Calibration	☐ Temperature/Cure
☐ Wave/Twist in Tube	☐ Fit/Function	☐ Out of Sequence	☐ Weld
			☐ Wrong Stock Pulled
			☐ Other

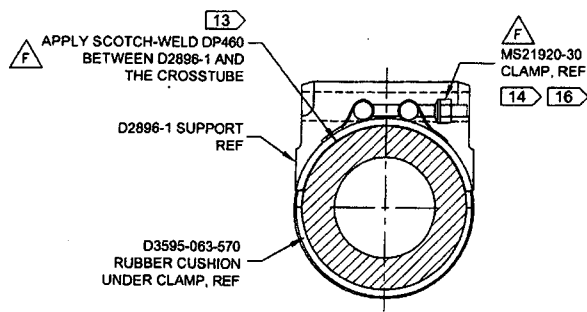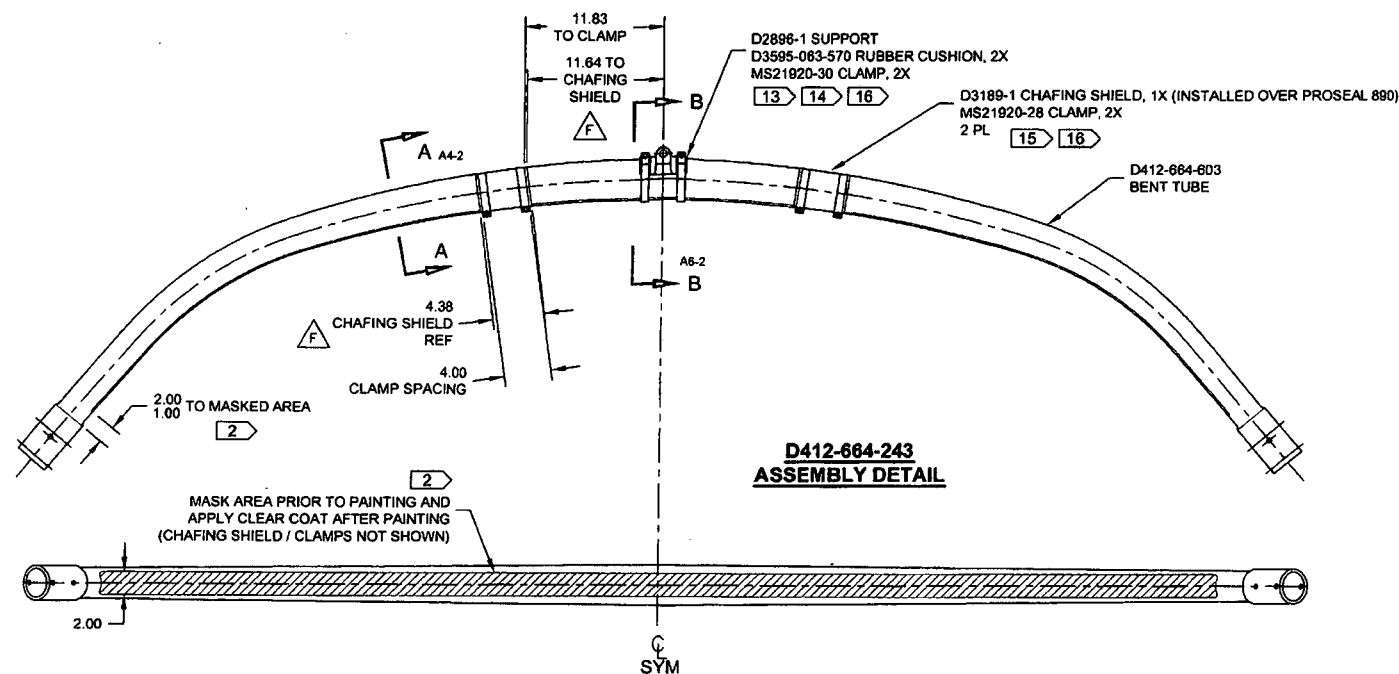

SECTION B-B D4-2
SCALE 4X

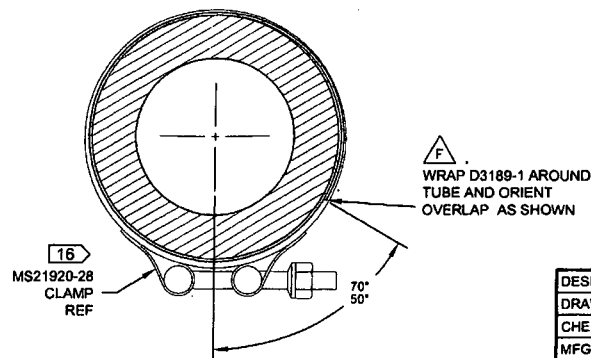

SECTION A-A D6-2
SCALE 6X

RELEASED
2014-05-26
ND

DESIGN	Q	DART AEROSPACE LTD	
DRAWN	Q	HAWKESBURY, ONTARIO, CANADA	
CHECKED	W	DRAWING NO.	REV. F
MFG. APPR.		D412-664-243	SHEET 2 OF 4
APPROVED	W	TITLE	SCALE
DE APPR.		CROSTUBE ASSEMBLY (412 HI AFT)	NTS
DATE	14.04.01	COPYRIGHT © 2001 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐


Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width:100%;"> <tr> <td>Skid-tube ☐</td> <td>Crosstube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									


FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence	☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	--	---	--


8 7 6 5 4 3 2 1

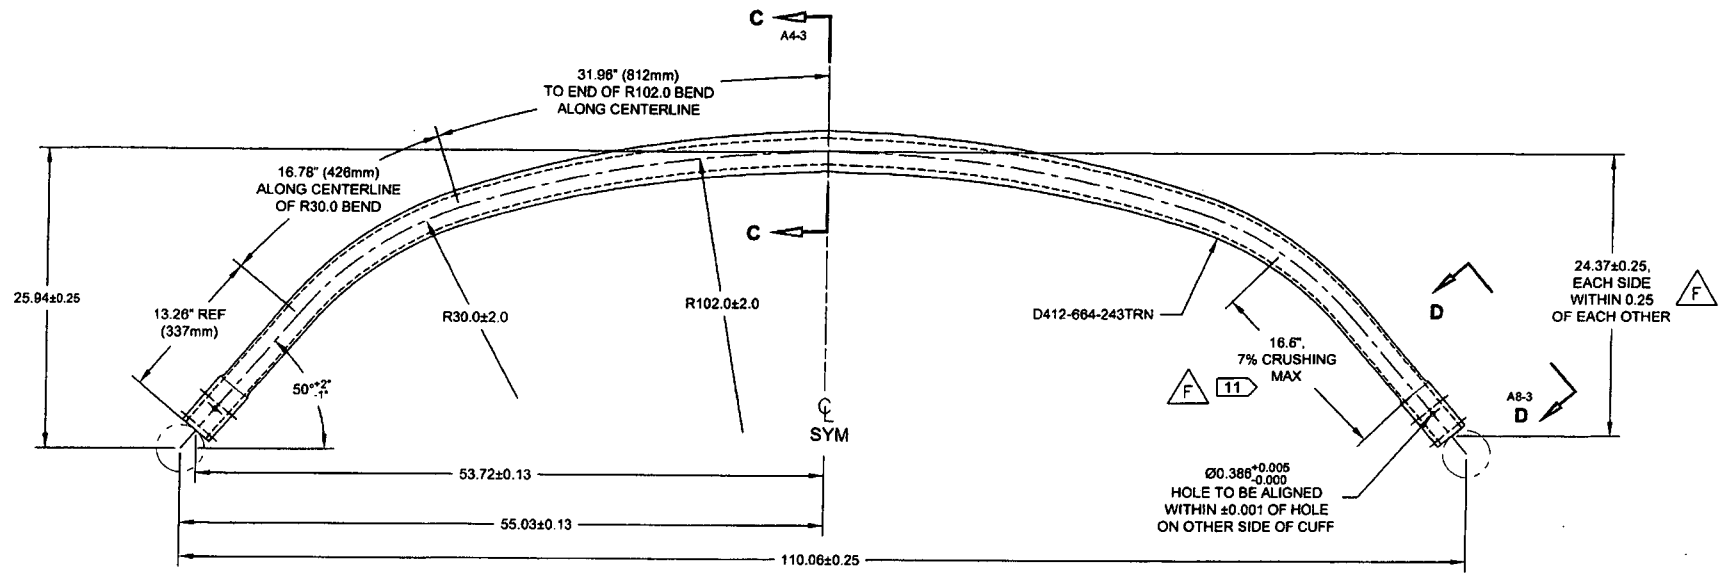

D412-664-603
BENDING AND DRILLING DETAIL

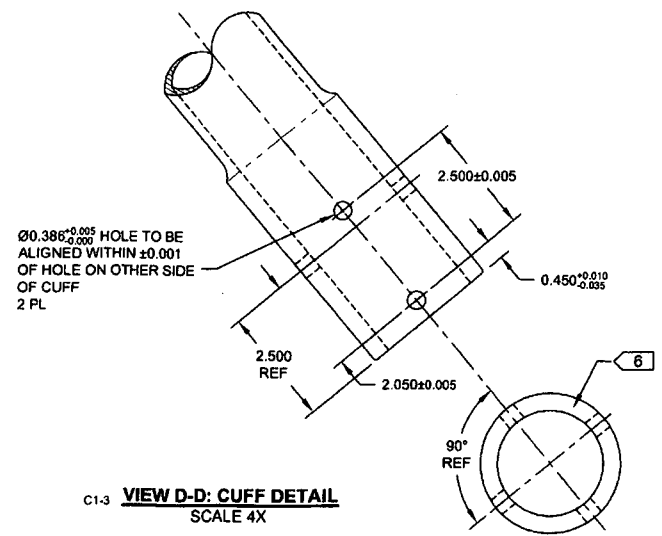

C1-3 **VIEW D-D: CUFF DETAIL**
SCALE 4X

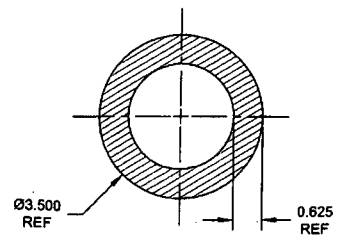

SECTION C-C D5-3
SCALE 4X

RELEASED
2014-05-26

DESIGN	9	DART AEROSPACE LTD	
DRAWN	9	HAWKESBURY, ONTARIO, CANADA	
CHECKED	DW	DRAWING NO.	REV. F
MFG. APPR.	JS	D412-664-243	SHEET 3 OF 4
APPROVED	MS	TITLE	SCALE
DE APPR.	JS	CROSSTUBE ASSEMBLY (412 HI AFT)	NTS
DATE	14.04.01	COPYRIGHT © 2001 BY DART AEROSPACE LTD This document is private and confidential and is supplied on the express condition that it is not to be used for any purpose other than that for which it was supplied without written permission from Dart Aerospace Ltd.	

8 7 6 5 4 3 2 1

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____





Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube ☐</td> <td>Crosstube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	--	---

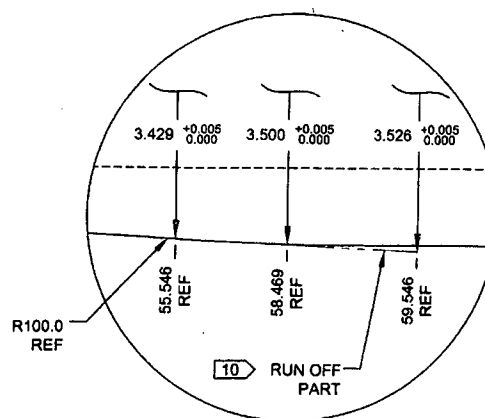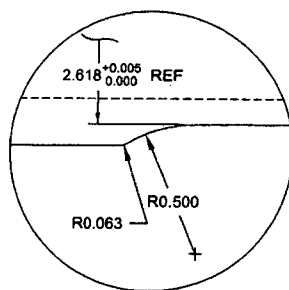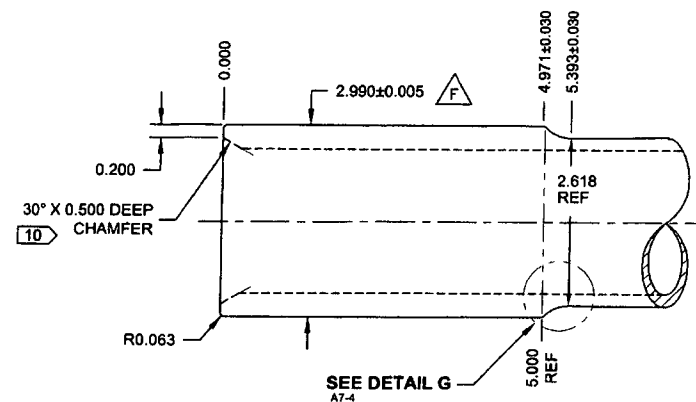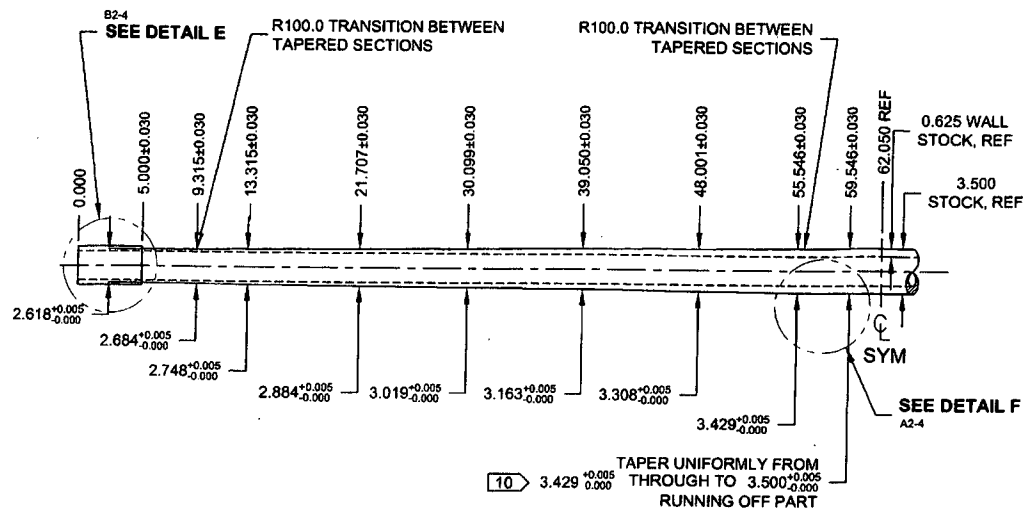

DETAIL F: TAPER RUN-OFF

NOT TO SCALE

DETAIL E: CROSSTUBE CUFF

SCALE 5X

DETAIL G: CUFF TRANSITION

SCALE 10X

DESIGN	<i>qp</i>	DART AEROSPACE LTD	
DRAWN	<i>qp</i>	HAWKESBURY, ONTARIO, CANADA	
CHECKED	<i>SW</i>	DRAWING NO.	REV. F
MFG. APPR.	<i>SW</i>	D412-664-243	SHEET 4 OF 4
APPROVED	<i>SW</i>	TITLE	SCALE
DE APPR.	<i>SW</i>	CROSSTUBE ASSEMBLY (412 HI AFT)	NTS
DATE	14.04.01	COPYRIGHT © 2001 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED IN ANY FORM OR BY ANY MEANS WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

RELEASED

2014-05-26

D412-664-243TRN

TURNING DETAIL

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube ☐</td> <td>Crosstube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence
		☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge
		☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other

412-664-203 Crosstube

BATCH:

Setup:

- 3.5" rollers for middle bend
- side bends use 3.375 rollers

*******MAKE SURE TOWERS ARE AT CORRECT HEIGHT BEFORE DOING INITIAL APPROACH*******

Lines:

29" & 32" from Centerline & 22.25" from cuffs.

Middle Bend

(buggy A 1.75" on cuff)

3.5" Rollers.run prog (odd#'s) M1-3-5-7-9-11-13 CHECK. Run 14,15,16 **AS REQUIRED**, to bend middle. Bend both tubes of Kanban before changing rollers to 3.375"

Approach is **2900** on both rollers, starting @ 32" line on tube with longer end of tube on **LARGE TABLE**.

NOTE: reference lines **MUST** match up with tangent lines if not the side bends will not work properly. (Hand made ref. line on board 412). Middefix starts at center line

Side bends

(buggy A 1.75" on cuff) **LARGE TABLE**

After changing rollers, start program run 412-side 1 to 5 from 29"line. **Y @ 1820 & W @ 3730** approaches for program 10 (up taper sets itself automatically on 22.25 line. Run program 10 and 12 up taper, repeat on second side then check. must reset approaches for each up taper program from this point on. **Y3500 W3730**.

Run additional programs as required to finish tube.

NOTES

-12/3/1 working with middlefix program to even out sides. after completely running middle programs, (up to 15) ran middlefix program with under bent side on large table, from centre line. we had a difference of about .100" between the two sides before running. afterwards we had two perfect matching measurements for middle bend. approach for middle program was **W2855/3095Y**.

-13/01/24... middle bend (1,3,5,7,9,11,13).....sides 1,2,3,4,5,10,12 CHECK ..run 14,16,18 etc. as needed checking between each program! MO

PASSES:

1
2
3
4
5
6
7
8
9
10
11
12
13
14
15
16
17
18
19
19A
19AA

1
2
3
4
5
6
7
8
9
10
11
12
13
check

1
2
3
4
5
6
7
8
9
10
11
12
13
14
15
16
17
18
19
19A
19AA

Dart Aerospace Ltd.
1270 Aberdeen Street
Hawkesbury, ON K6A 1K7
Tel: 613 632 9577
Fax: 613 632 1053

PURCHASE ORDER

Purchase Order ID PO27380

Purchase Order Date 2/9/2015

PO Print Date 2/9/2015

Page Number 2 of 3

Order From :
SKYSERVICE
6120 MIDFIELD ROAD
MISSISSAUGA, ONTARIO L5P 1B1
CANADA

VC-SKY001

Ship To : DART AEROSPACE LTD
1270 ABERDEEN
HAWKESBURY, ON K6A 1K7
CANADA

Contact Name

Vendor Phone 905-678-5636

Ship To Contact

Ship To Phone

Ship Via: Delivered

Ship Acct:

Buyer

Chantal Lavoie

Customer POID

Customer Tax # 10127-2607

Terms Net 30

Currency CAD

FOB FCA - (Free Carrier)

3	128041	D412-664-203 CROSSTUBE	2/9/2015	1.00	✓	\$155.00	\$155.00
---	--------	---------------------------	----------	------	---	----------	----------

Yes
2/9/2015

LIQUID PENETRANT INSPECTION AS PER QSI 038 OR
LPI AS PER ASTM 1417 LEVEL 2

SP15-029

Line Total: \$155.00

4	128042	D412-664-203 CROSSTUBE	2/9/2015	1.00		\$155.00	\$155.00
---	--------	---------------------------	----------	------	--	----------	----------

Yes
2/9/2015

LIQUID PENETRANT INSPECTION AS PER QSI 038 OR
LPI AS PER ASTM 1417 LEVEL 2

Line Total: \$155.00

5	128043	D412-664-203 CROSSTUBE	2/9/2015	1.00		\$155.00	\$155.00
---	--------	---------------------------	----------	------	--	----------	----------

Yes
2/9/2015

LIQUID PENETRANT INSPECTION AS PER QSI 038 OR
LPI AS PER ASTM 1417 LEVEL 2

Note:

2/9/2015

**skyservice****Work Order Traveler**

Sky Service F.B.O. Inc.

DOT APP 53-89 / EASA 145.7142 / BDA AMO 385

WO #: MWO23577	Customer: Dart Aerospace Ltd.	Dept: NDT YUL	Reference: PO27380
Descr:	PN:	S/N:	Qty: 1
Make:	Model:	Reg:	A/C S/N:
TSN:	CSN:	TSO:	
Task: UNSCHEDULED			Sequence: 1

Work Required:

CARRY OUT NDT ON 4 AFT CROSSTUBES-HIGH AND 1 FUEL TANK ASSY.

4 AFT CROSSTUBES-HIGH ID# D412-664-203, WORK ORDERS ID# 128024, 128041, 128042, 128043

1 FUEL TANK ASSY ID# D4464-041, WORK ORDER ID# 127068

8015-029

Action Taken:						Date:	Initial/Stamp:
LIQUID PENETRANT C/O ON ITEMS LISTED ABOVE AS PER ASTM E-1417M-13						FEB 09 2015	
NO CRACK FOUND							
ARDROX 970P25E BATCH# 2312131, M-20141							
Description	Location	P/N	Qty	Batch	S/N Off	S/N On	

I certified that the maintenance described above has been performed in accordance with the applicable standard of airworthiness.

Signature:	ACA/SCA Stamp	Date:
Name: RAFIK MELIKIAN		FEB 09 2015

DQA:

Date: 15/03/18



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed:

Date:

15/03/17.

Work Order update only ☐

Work Order: 128041

Part No. D412-664-203

NCR No. 15-4623

DISPOSITION

Rework ☐

Scrap ☐

Use-as-is ☒

Suspected Unapproved ☐

AGAINST DEPARTMENT/PROCESS

Skid-tube ☐ Crosstube ☒ Water Jet ☐ Engineering ☐

Machining ☐ Small Fab ☐ Prod. Eng. Coord. ☐ Quality ☐

Thermoforming ☐ Finishing ☐ Rec/Store/Packaging ☐ Other ☐

Large Fab ☐ Composite ☐ Supplier ☐

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design	15/2/18		1	Instruction for applying clear-coat window does not match actual process.	DAS 12 9-89 15/2/18	Acceptable to apply clear coat prior to white paint.	DAS 12 9-89 15/2/18	DAS 9 9-89 150309	DAS 9 9-89 150309
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear	General		
☐ Bending	☐ Bend	☐ Folio/Program	☐ Outside Dimensions
☐ Centre Not Concentric	☐ BOM/Route	☐ Grain	☐ Over/Under tolerance
☐ Cracks	☐ Broken/Damage/Defect	☐ Hardware	☐ Part Incorrect
☐ Crimp/Kink/Ripple/Wave	☐ Burrs	☐ Inspection Incomplete/Unqualified	☐ Part Lost/Missing
☐ Cuffs	☐ Contamination	☐ Instructions Incomplete/Unclear	☐ Part Moved
☐ Crushing	☐ Countersink	☐ Misaligned/off center	☐ Positioned Wrong
☐ Heat Treat	☐ Cut Too Short	☐ Mislabeled	☐ Power Loss/Surge
☐ Inspection Strip in Tube	☐ Drawing	☐ Misread	☐ Pressure/Forced
☐ Marks/Chatter	☐ Drill Holes	☐ Off-set	☐ Set-up
☐ Turning Sequence	☐ Finish	☐ Out of Calibration	☐ Temperature/Cure
☐ Wave/Twist in Tube	☐ Fit/Function	☐ Out of Sequence	☐ Weld
			☐ Wrong Stock Pulled
			☐ Other